


Cable Cleat

Chart 1

Cable Size	Dimensions			Cable Range		Pack Qty	Carton Qty
	A	B	C	Min	Max		
C4	15.0	15.0	27.0	7.7	10.0	100	4000
C5	17.0	16.0	29.7	10.1	12.7	100	3600
C6	19.5	16.5	33.0	12.6	15.2	100	3000
C7	25.0	19.5	36.0	15.1	17.8	100	2800
C8	26.0	19.5	38.0	17.7	20.3	100	1800
C9	29.0	19.5	42.0	20.2	22.8	100	1600
C10	32.5	22.0	46.0	22.7	25.4	100	1200
C11	36.0	25.0	50.5	25.3	27.7	50	1500
C12	40.0	25.0	59.0	27.6	30.5	50	1200
C14	46.5	25.0	63.0	30.4	35.5	50	700
C16	52.0	25.0	69.0	35.4	40.6	50	600
C18	58.0	25.0	72.5	40.5	45.7	50	400
C20	60.0	25.0	72.0	45.6	50.8	50	400

This guide is for reference only and sizing should be checked before confirming.

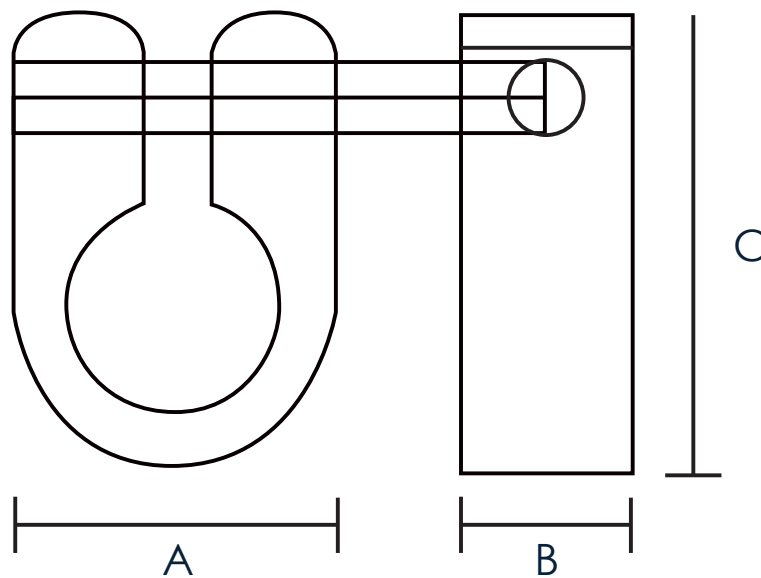

Cable Cleat

Chart 2

Cable Size	Cores	Cable OD mm	Cleat
1.5	2	12.3	C5
	3	12.8	C6
	4	13.5	C6
	5	14.2	C6
	6	15.2	C6
	7	15.2	C6
	8	17.6	C7
	10	19.8	C8
	12	19.4	C8
2.5	16	21.9	C9
	2	13.6	C6
	3	14.1	C6
	4	15	C6
	5	16	C7
	6	17.1	C7
	7	17.1	C7
	8	18.8	C8
	10	21.4	C9
4	12	22.4	C9
	16	25	C10
	2	14.7	C6
6	3	15.3	C7
	4	16.4	C7
	2	15.9	C7
10	3	16.6	C7
	4	18.7	C8
	2	18	C8
10	3	19.5	C8
	4	21.1	C9

Continued on next page...

Cable Size	3Cores	Cable OD mm	Cleat
16	2	20	C8
	3	21.2	C9
	4	22.9	C10
25	2	24.1	C10
	3	26.7	C11
	4	28.9	C12
35	2	27.9	C12
	3	29.6	C12
	4	32.1	C14
50	1	17.5	C7
	2	25.8	C11
	3	28.5	C12
	4	32	C14
70	1	17.5	C7
	2	25.8	C11
	3	28.5	C12
	4	32	C14
95	1	22.3	C9
	2	33.1	C14
	3	37	C16
	4	41.7	C18
120	1	24.2	C10
	2	36.1	C16
	3	40.4	C16
	4	47.1	C20
150	1	27.4	C11
	2	39.3	C16
	3	45.5	C18
185	1	30	C12
	2	44.7	C18
	3	49.8	C20
240	1	32.8	C14
	2	49	C20
300	1	35.6	C16
400	1	40.4	C16
500	1	44.2	C18
630	1	48.8	C20